

Id 43355

Models LM - New Range Rover  
LA - Discovery 3  
LS - Range Rover Sport  
LF - Freelander 2  
LA - Discovery 4

Title Exterior mirrors Judder on power fold operation

Last Modified 15-FEB-2010 13:13

Category Body

Symptom 103000 Mirrors

**Issue:** There have been customer complaints of the exterior mirrors Juddering when power folding on vehicles before VIN H179417.

**Cause:** This Judder is caused by the lubricant on the pivot mechanism wearing off or drying out.

Content **Action:** If any dealer has a vehicle before VIN H179417 with this condition, manually move the mirror through it's full travel inboard and full travel outboard until the mirror stops, then move the mirror back until it clicks into the detent at it's normal driving position.. Do not force the mirror beyond it's natural travel as this may cause damage. This action will relubricate the pivot mechanism eliminating the Judder.