



SSM41748v2 – Diesel Engine Overheats

Reference	SSM41748
Models	Freelander 2
Title	Diesel Engine overheats, cooling fans inoperative
Category	Engine
Last modified	09-Nov-2010 00:00:00
Symptom	402000 Cooling System Concerns

Issue:

Vehicle may over heat

Cause:

Twin Cooling fans Inoperative due to a software issue in the PWM control module.

Action:

Content

For customer concerns relating to cooling fans being inoperative please disconnect the battery or remove the fuse that protects the cooling fan circuit for approximately 10 seconds and then reconnect the battery terminal or refit fuse.

Check the cooling fans for correct operation.

If the cooling fans operate then the fan control module or cooling fan assembly (which ever is most appropriate) will need replacing in order to prevent a potential re-occurrence of this issue.

All service stock is clear of this problem and the issue is now resolved from vehicle VIN H137528